# Technical data sheet



**Product:** 731

Manufacturer: PERMABOND ENGINEERING ADHESIVES

Product group: **KLEBSTOFF** 

Article group: **CYANACRYLAT** 

Download: 02.05.2024

PERMABOND® 731

This data sheet was provided to you by Tewipack Uhl GmbH. The company tewipack Uhl GmbH assumes no responsibility for the topicality and the Accuracy of the information contained. The properties of the products can vary due to various influences such as composition and condition of the Substrate, impurities in or on the substrate, temperature and humidity at the Change storage and environmental conditions during use. Using this product in combination with other material, the customer is responsible for to check through our own tests whether the product is suitable for the planned combination and whether this combination delivers the expected results





Cyanoacrylate
Technical Datasheet

#### Features & Benefits

- Longer cure allows accurate alignment
- Toughened and flexible
- Ease of use no mixing or heat cure
- Bonds most materials
- 100% reactive, no solvents

# Biocompatibility

ISO 10993-5 Cytotoxicity

#### Description

PERMABOND® 731 is a toughened cyanoacrylate with very good impact and peel strength when compared to a conventional cyanoacrylate. It bonds rapidly at room temperature and its viscosity is stable over the shelf life of the product. This provides consistent performance. The product adheres to a variety of surfaces including steel, aluminum, galvanized steel, plastics and elastomers.

### **Physical Properties of Uncured Adhesive**

Chemical composition	Ethyl cyanoacrylate
Appearance	Colourless
Viscosity @ 25°C	150 mPa.s <i>(cP)</i>
Specific gravity	1.1

## **Typical Curing Properties**


Maximum gap fill	0.15 mm <i>0.006 in</i>
Fixture / handling time* (0.3 N/mm² shear strength is achieved)	<30 seconds (Steel) 120-180 seconds (Aluminium) 15-20 seconds (Buna N Rubber) 30-45 seconds (ABS) 15-20 seconds (Neoprene) <30 seconds (Phenolic)
Full strength	24 hours

<sup>\*</sup>Handling times can be affected by temperature, humidity and specific surfaces being bonded. Larger gaps or acidic surfaces will also reduce cure speed but this can be overcome by the use of Permabond C Surface Activator (CSA) or Permabond QFS 16.

### Typical Performance of Cured Adhesive

	,,		•
	Shear strength* (ISO4587)	Steel	24-30 N/mm² (3500-4400 psi)
		Aluminium	13-15 N/mm² (1900-2200 psi)
		Zinc	10 N/mm² (1450 psi)
		PVC	5.5 N/mm² (800psi)
		Acrylic	4 N/mm² (700 psi)
	Peel Strength	40-60 N/25mm <i>(9-13 PIW)</i>	
	(ASTM D-903)		
	Impact strength	5-10 kJ/m² (2.4-4.8 ft-lb/in²)	
	(ASTM D-950)		
	Dielectric constant	2.5	
	@10kHz	2.5	
	Dielectric strength	25 kV/mm	
	Dicicettic strength		
	Coefficient of	90 x 10 <sup>-6</sup> mm/mm/°C	
	thermal expansion		
	Coefficient of	0.1 W/(m.K)	
	thermal		
	conductivity		
	Hardness (ISO868)	85 Shore D	
	1101011033 (130000)		

<sup>\*</sup>Strength results will vary depending on the level of surface preparation and gap.

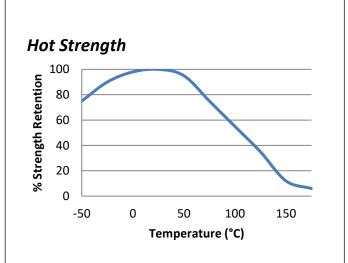


"Hot strength" shear strength tests performed on mild steel. 24hr cure at room temperature and conditioned to pull temperature for 30 minutes before testing.

731 can withstand higher temperatures for brief periods (such as for paint baking and wave soldering processes) providing the joint is not unduly stressed. The minimum temperature the cured adhesive can be exposed to is -55°C (-65°F) depending on the materials being bonded.

The information given and the recommendations made herein are based on our research and are believed to be accurate but no guarantee of their accuracy is made. In every case we urge and recommend that purchasers before using any product in full-scale production make their own tests to determine to their own satisfaction whether the product is of acceptable quality and is suitable for their particular purpose under their own operating conditions. THE PRODUCTS DISCLOSED HEREIN ARE SOLD WITHOUT ANY WARRANTY AS TO MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OR ANY OTHER WARRANTY, EXPRESS OR IMPLIED.

No representative of ours has any authority to waive or change the foregoing provisions but, subject to such provisions, our engineers are available to assist purchasers in adapting our products to their needs and to the circumstances prevailing in their business. Nothing contained herein shall be construed to imply the non-existence of any relevant patents or to constitute a permission, inducement or recommendation to practice any invention covered by any patent, without authority from the owner of this patent. We also expect purchasers to use our products in accordance with the guiding principles of the Chemical Manufacturers Association's Responsible Care® program.

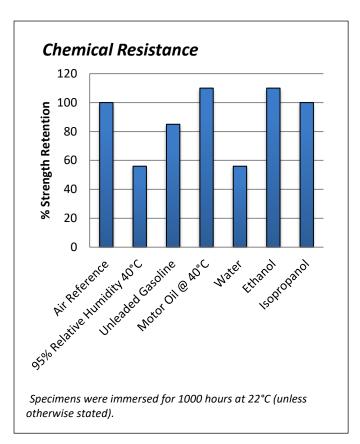

#### **Additional Information**

This product is not recommended for use in contact with strong oxidizing materials and polar solvents although will withstand a solvent wash without any bond strength deterioration. Users are reminded that all materials, whether innocuous or not, should be handled in accordance with the principles of good industrial hygiene. Full information can be obtained from the Safety Data Sheet.

This Technical Datasheet (TDS) offers guideline information and does not constitute a specification.

## Storage & Handling

Storage Temperature	2 to 7°C (35 to 45°F)

Allow adhesive to reach room temperature before opening bottle to prevent condensation inside the bottle which can reduce shelf life.

#### **Surface Preparation**

Surfaces should be clean, dry and grease-free before applying the adhesive. Use a suitable solvent (such as acetone or isopropanol) for the degreasing of surfaces. Some metals such as aluminium, copper and its alloys will benefit from light abrasion with emery cloth (or similar), to remove the oxide layer.

#### **Directions for Use**

- 1) Apply the adhesive sparingly to one surface.
- 2) Bring the components together quickly and correctly aligned.
- 3) Apply sufficient pressure to ensure the adhesive spreads into a thin film.
- 4) Do not disturb or re-align until sufficient strength is achieved, normally in a few seconds.
- 5) Any surplus adhesive can be removed with Permabond CA solvent, nitromethane or acetone.

#### NB:

For difficult or porous surfaces using a Permabond activator is recommended. If bonding polypropylene, polyethylene, PTFE or silicone, prime first with Permabond Polyolefin Primer (POP).

#### Video Links

Surface preparation: https://youtu.be/8CMOMP7hXjU



Cyanoacrylate directions for use: https://youtu.be/PiPzutdRmsk



www.permabond.com

UK: 0800 975 9800
 General Enquiries: +44 (0)1962 711661

• US: 732-868-1372 • Asia: + 86 21 5773 4913

info.europe@permabond.com info.americas@permabond.com info.asia@permabond.com

The information given and the recommendations made herein are based on our research and are believed to be accurate but no guarantee of their accuracy is made. In every case we urge and recommend that purchasers before using any product in full-scale production make their own tests to determine to their own satisfaction whether the product is of acceptable quality and is suitable for their particular purpose under their own operating conditions. THE PRODUCTS DISCLOSED HEREIN ARE SOLD WITHOUT ANY WARRANTY AS TO MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OR ANY OTHER WARRANTY, EXPRESS OR IMPLIED.

No representative of ours has any authority to waive or change the foregoing provisions but, subject to such provisions, our engineers are available to assist purchasers in adapting our products to their needs and to the circumstances prevailing in their business. Nothing contained herein shall be construed to imply the non-existence of any relevant patents or to constitute a permission, inducement or recommendation to practice any invention covered by any patent, without authority from the owner of this patent. We also expect purchasers to use our products in accordance with the guiding principles of the Chemical Manufacturers Association's Responsible Care® program.