

Technical data sheet



Product: ES566

Manufacturer: PERMABOND ENGINEERING ADHESIVES

Product group: KLEBSTOFF

Article group: 1-K KLEBSTOFF

Download: 12.03.2026

PERMABOND® ES566

This data sheet was provided to you by Tewipack Uhl GmbH. The company tewipack Uhl GmbH assumes no responsibility for the topicality and the Accuracy of the information contained. The properties of the products can vary due to various influences such as composition and condition of the Substrate, impurities in or on the substrate, temperature and humidity at the Change storage and environmental conditions during use. Using this product in combination with other material, the customer is responsible for to check through our own tests whether the product is suitable for the planned combination and whether this combination delivers the expected results

Tewipack Uhl GmbH
Industriestraße 15
D-75382 Althengstett

Telephone:
+49(0)7051/9297-0
Fax:
+49(0)7051/9297-99

E-Mail:
info@tewipack.de
Website:
www.tewipack.de

Managing director:
Alexander Uhl,
Michael Uhl
HRB 330424
Amtsgericht
Stuttgart

Bank details:
Sparkasse
Sindelfingen
Pforzheim
Calw
BLZ 666 500
85
Konto 17 787

Commerzbank
Sindelfingen
BLZ 603 400 71
Konto 8 001 166

Vereinigte
Volksbank AG
Böblingen
BLZ 603 900 00
Konto 80 089
003

Postbank
Stuttgart
BLZ 600 100
70
Konto 146
294 708

Features & Benefits

- 💧 Excellent adhesive strength
- 💧 Rapid cure at low temperature
- 💧 Easy to use – no mixing required
- 💧 High shear and peel strength
- 💧 High temperature resistance
- 💧 Suitable for hard to bond plastics

Description

PERMABOND® ES566 is a single-part epoxy adhesive which has excellent adhesion to metal surfaces, composites and difficult to bond plastics (such as Nylon, PBT etc.). The high bond strength of this adhesive allows it to replace mechanical fastening, soldering or brazing. It has a rapid cure - 25 minutes at 120°C and can be cured at temperatures as low as 90°C.

Physical Properties of Uncured Adhesive

Chemical composition	Epoxy Resin
Appearance	Grey
Viscosity @ 25°C	20rpm: 60,000-120,000 mPa.s (cP) 2rpm: 150,000-300,000 mPa.s (cP)
Specific gravity	1.3

Typical Curing Properties


Flow at high temperature	No flow
Maximum gap fill	2 mm 0.08 in
Cure speed (oven) *	90°C (190°F): 75 minutes 100°C (210°F): 40 minutes 120°C (250°F): 25 minutes 150°C (300°F): 10 minutes
Cure speed (induction)	<3 minutes

*Actual cure times will depend on the time it takes for the adhesive to reach this temperature - for example, large assemblies or a crowded oven will require longer to reach full cure. Alternative, quicker methods of curing include induction, hotplates, infrared lamps and hot-air guns.

Typical Performance of Cured Adhesive

Shear strength* (ISO4587)	Steel (adhesive cured at 90°C) 5-10 N/mm ² (750 – 1500 psi) Steel (adhesive cured at >100°C) 18-22 N/mm ² (2600 – 3200 psi)
Hardness (ISO868)	>70 Shore D
Coefficient of thermal expansion	45 x 10 ⁻⁶ mm/mm/°C
Thermal conductivity	0.38 W/(m.K)

Hot Strength

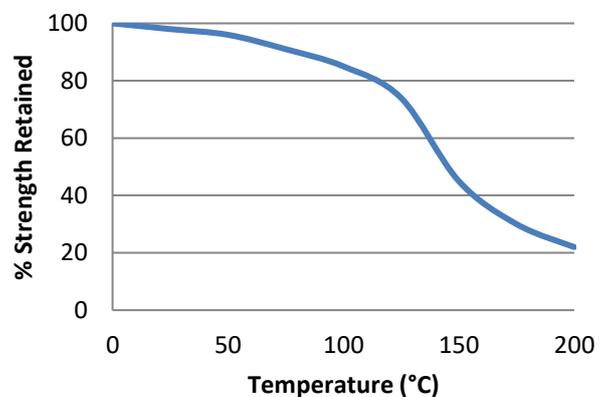


“Hot strength” shear strength tests performed on mild steel. Fully cured then conditioned to pull temperature for 30 minutes before testing.

ES566 can withstand higher temperatures for brief periods (such as for paint baking and wave soldering processes) providing the joint is not unduly stressed. The minimum temperature the cured adhesive can be exposed to is -40°C (-40°F) depending on the materials being bonded.

The information given and the recommendations made herein are based on our research and are believed to be accurate but no guarantee of their accuracy is made. In every case we urge and recommend that purchasers before using any product in full-scale production make their own tests to determine to their own satisfaction whether the product is of acceptable quality and is suitable for their particular purpose under their own operating conditions. THE PRODUCTS DISCLOSED HEREIN ARE SOLD WITHOUT ANY WARRANTY AS TO MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OR ANY OTHER WARRANTY, EXPRESS OR IMPLIED.

No representative of ours has any authority to waive or change the foregoing provisions but, subject to such provisions, our engineers are available to assist purchasers in adapting our products to their needs and to the circumstances prevailing in their business. Nothing contained herein shall be construed to imply the non-existence of any relevant patents or to constitute a permission, inducement or recommendation to practice any invention covered by any patent, without authority from the owner of this patent. We also expect purchasers to use our products in accordance with the guiding principles of the Chemical Manufacturers Association's Responsible Care® program.

Chemical Resistance

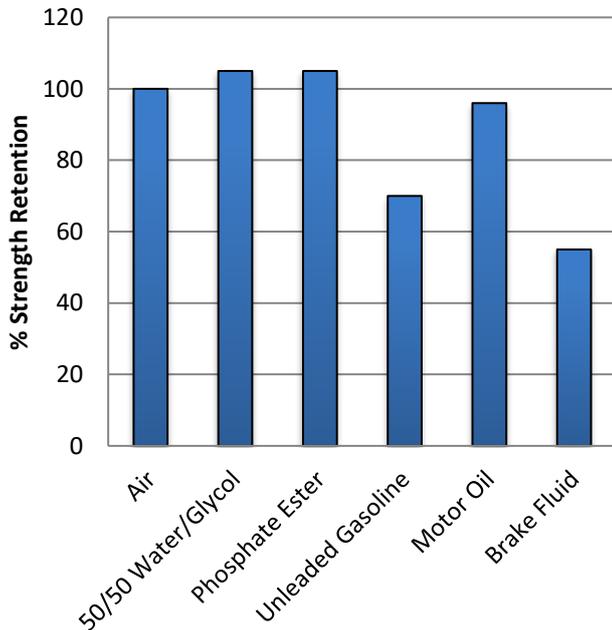

Specimens were immersed for 30 days at 85°C and tested at room temperature.

Additional Information

This product is not recommended for use in contact with strong oxidizing materials.

Information regarding the safe handling of this material may be obtained from the safety data sheet (SDS).

Users are reminded that all materials, whether innocuous or not, should be handled in accordance with the principles of good industrial hygiene.

This Technical Datasheet (TDS) offers guideline information and does not constitute a specification.

Storage & Handling

Storage Temperature	2 to 7°C (35 to 45°F)
---------------------	-----------------------

Surface Preparation

Surfaces should be clean, dry and grease-free before applying the adhesive. Use a suitable solvent (such as acetone or isopropanol) for the degreasing of surfaces. Some metals such as aluminium, copper and its alloys will benefit from light abrasion with emery cloth (or similar), to remove the oxide layer.

Directions for Use

- 1) The adhesive should be dispensed from the bottle via the nozzle supplied (this can be cut to give the appropriate sized bead to cover the bond area).
- 2) Apply the adhesive to one surface and avoid entrapping air.
- 3) Assemble parts applying sufficient pressure to ensure the adhesive spreads to cover the entire bond area.
- 4) Use a jig / clamp to prevent parts moving during cure.
- 5) It is advisable not to disturb the joint until the adhesive is fully cured.
- 6) Cure with heat – see page one for cure schedule.

Video Links

Surface preparation:

<https://youtu.be/8CMOMP7hXjU>



Single-part epoxy directions for use:

[https://youtu.be/ KupaieuuZw](https://youtu.be/KupaieuuZw)



www.permabond.com

- UK: 0800 975 9800
- General Enquiries: +44 (0)1962 711661
- US: 732-868-1372
- Asia: + 86 21 5773 4913

info.europe@permabond.com

info.americas@permabond.com

info.asia@permabond.com

The information given and the recommendations made herein are based on our research and are believed to be accurate but no guarantee of their accuracy is made. In every case we urge and recommend that purchasers before using any product in full-scale production make their own tests to determine to their own satisfaction whether the product is of acceptable quality and is suitable for their particular purpose under their own operating conditions. THE PRODUCTS DISCLOSED HEREIN ARE SOLD WITHOUT ANY WARRANTY AS TO MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OR ANY OTHER WARRANTY, EXPRESS OR IMPLIED.

No representative of ours has any authority to waive or change the foregoing provisions but, subject to such provisions, our engineers are available to assist purchasers in adapting our products to their needs and to the circumstances prevailing in their business. Nothing contained herein shall be construed to imply the non-existence of any relevant patents or to constitute a permission, inducement or recommendation to practice any invention covered by any patent, without authority from the owner of this patent. We also expect purchasers to use our products in accordance with the guiding principles of the Chemical Manufacturers Association's Responsible Care® program.

Permabond ES566

Global TDS Revision 9

21 November 2019

Page 2/2

FOR PROFESSIONAL OR INDUSTRIAL USE ONLY. KEEP OUT OF REACH OF CHILDREN